

**Occupied Bandwidth and
Spurious Emissions Measurements**
To Demonstrate Compliance with
Section 73.317(b) through 73.317(d) of the
FCC Rules and Regulations

Citicasters Licenses, L.P.
WMTX(FM) – 100.7 MHz
Tampa, FL (Facility ID No: 23078)
WFLZ-FM – 93.3 MHz
Tampa, FL (Facility ID No: 29732)
WFUS(FM) – 103.5 MHz
Gulfport, FL (Facility ID No: 63984)

Cox Radio, Inc.
WWRM(FM) – 94.9 MHz
Tampa, FL (Facility ID No: 74200)
WPOI(FM) – 101.5 MHz
St. Petersburg, FL (Facility ID No: 66013)

October 6, 2011

Occupied Bandwidth and Spurious Emissions Measurements

Measurements were conducted to demonstrate that WWRM(FM), Tampa, FL, WMTX(FM), Tampa, FL, WFLZ-FM, Tampa, FL, WPOI(FM), St. Petersburg, FL and WFUS(FM), Gulfport, FL operating into a combined auxiliary antenna system, comply with section 73.317(b) through 73.317(d) of the FCC Rules and Regulations. Randall L. Mullinax conducted the measurements on October 6, 2011, with all stations simultaneously utilizing the shared antenna. The spectrum analyzer used for the measurements was an Agilent Technologies model E4402B, S/N MY41441731. A sample of the signals of all 5 stations was derived from the main transmission line at the output of the combiner and was coupled to the analyzer using a short length of RG-223 50Ω double-shielded coaxial cable. Two 6 dB pads (Bird model 5-A-MFN-06 or equivalent) were inserted ahead of the analyzer to avoid overload and to provide isolation.

The lowest measured unmodulated carrier level of the five stations was -5 dBm and was used as the reference for all harmonic, spurious and intermodulation measurements. All measurements were conducted with the transmitters and associated equipment adjusted as used in normal program operation.

For all occupied bandwidth measurements, the spectrum analyzer was placed in the peak hold mode for at least 10 minutes per measurement before the waveforms were observed. As shown in Figures 1 through 5, all transmitters were observed to be in full compliance with section 73.317(b) of the FCC Rules with emissions appearing on frequencies removed from the carrier frequencies by between 120 kHz and 240 kHz attenuated by at least 25 dB below the unmodulated carrier level indicating the occupied bandwidth of each transmitter to be 240 kHz or less. All transmitters were also observed to be in full compliance with section 73.317(c) of the FCC Rules with emissions appearing on frequencies removed from the carrier frequencies by between 240 kHz and 600 kHz attenuated by at least 35 dB.

Figure 1
WWRM(FM)

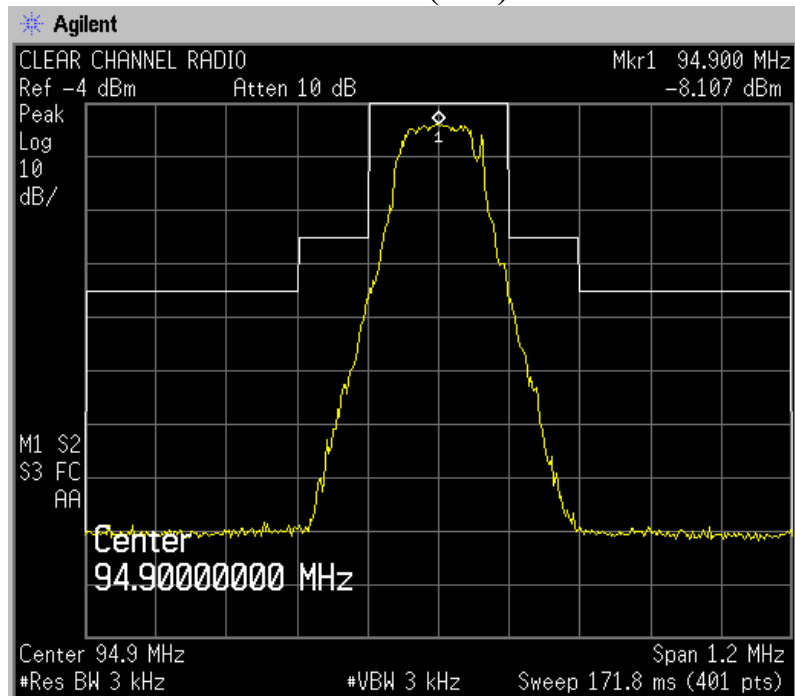


Figure 2
WMTX(FM)

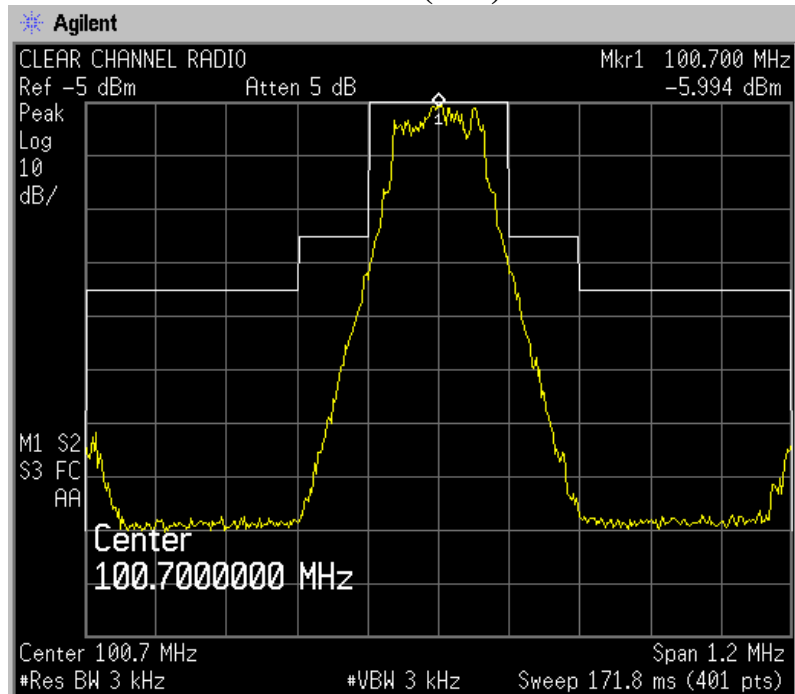


Figure 3
WFLZ-FM

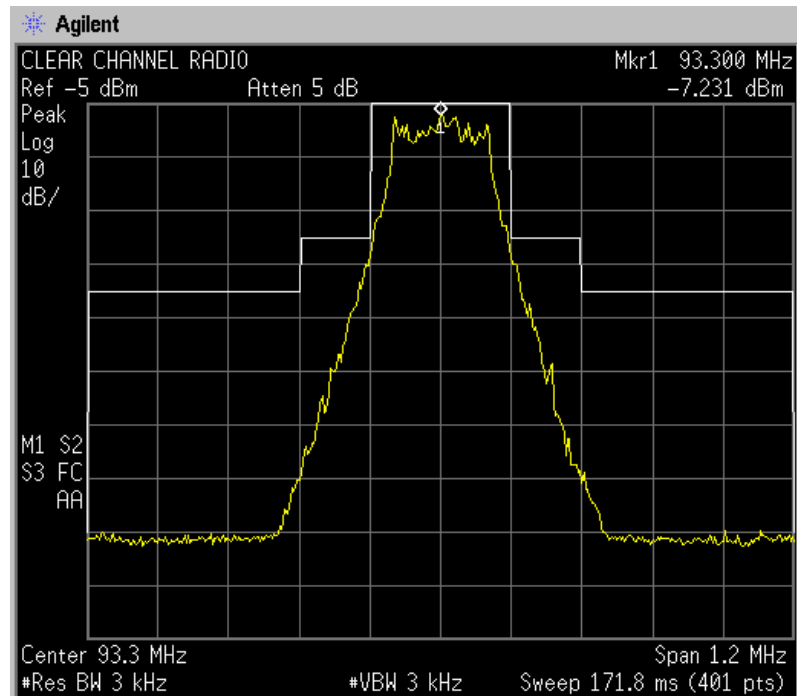


Figure 4
WPOI(FM)


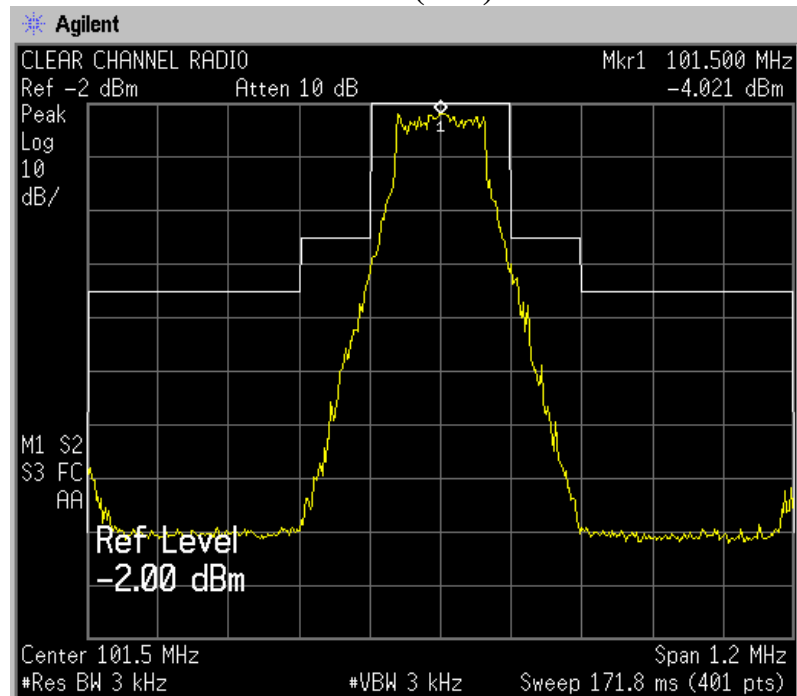


Figure 5
WFUS(FM)

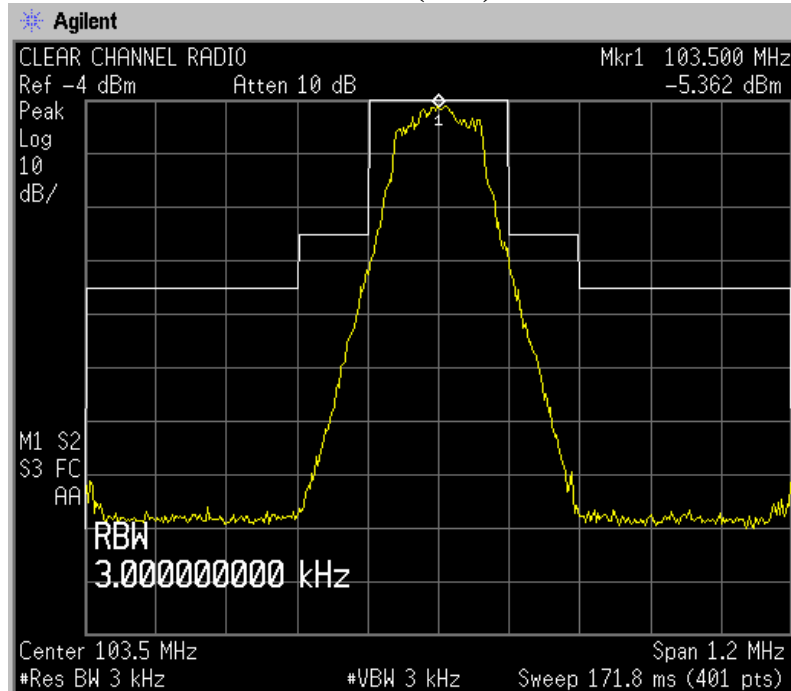

Extensive measurement were also conducted to insure that emissions appearing on frequencies removed from the carrier frequencies by more than 600 kHz were attenuated by at least 80 dB as required by section 73.317(d) of the FCC Rules. To facilitate these measurements, notch filters were placed between the two 6 dB pads so that the spectrum analyzer gain could be increased by up to 20 dB. The filters were necessary to avoid the possible generation of false spurious or intermodulation products in the analyzer. The attenuation of the notch filters was 49.8 dB at 94.9 MHz, 56.0 dB at 100.7 MHz, 43.3 dB at 93.3 MHz, 52.7 dB at 101.5 MHz and 38.8 dB at 103.5 MHz.

The most likely intermodulation frequencies through the 3rd order in the range 2.5 MHz to 550 MHz that could be produced by the combined operation of the five stations and harmonic frequencies were calculated and the results of the measurements at these frequencies are listed in Table 1.

Table 1

Frequency A	103.5
Frequency B	101.5
Frequency C	100.7
Frequency D	94.9
Frequency E	93.3

DESCRIPTION	FREQ. MHZ	ATTENUATION DB	DESCRIPTION	FREQ. MHZ	ATTENUATION DB
A + B	205	91	D+B+C	297.1	>100
A + (2 X B)	306.5	>100	D+B-C	95.7	89
B + (2 X A)	308.5	>100	B+C-D	107.3	93
2 X A	207	96	D+C-B	94.1	>100
(2 X A) - B	105.5	94	A + E	196.8	>100
2 X B	203	>100	A - E	10.2	>100
(2 X B) - A	99.5	90	A + (2 X E)	290.1	>100
3 X A	310.5	>100	E + (2 X A)	300.3	>100
3 X B	304.5	>100	(2 X A) - E	113.7	>100
A + C	204.2	92	2 X E	186.6	>100
A + (2 X C)	304.9	>100	(2 X E) - A	83.1	>100
C + (2 X A)	307.7	>100	3 X E	279.9	>100
(2 X A) - C	106.3	>100	B + C	202.2	>100
2 X C	201.4	>100	B + (2 X C)	302.9	>100
(2 X C) - A	97.9	91	C + (2 X B)	303.7	>100
3 X C	302.1	>100	(2 X B) - C	102.3	>100
A+B+C	305.7	>100	(2 X C) - B	99.9	>100
A+B-C	104.3	>100	B + D	196.4	>100
B+C-A	98.7	93	B - D	6.6	>100
A+C-B	102.7	>100	B + (2 X D)	291.3	>100
A + D	198.4	>100	D + (2 X B)	297.9	>100
A - D	8.6	>100	(2 X B) - D	108.1	>100
A + (2 X D)	293.3	>100	(2 X D) - B	88.3	>100
D + (2 X A)	301.9	>100	B + E	194.8	>100
(2 X A) - D	112.1	>100	B - E	8.2	>100
2 X D	189.8	>100	(2 X B) - E	109.7	>100
(2 X D) - A	86.3	>100	(2 X E) - B	85.1	>100
3 X D	284.7	>100	A+B+E	298.3	>100
A+B+D	299.9	>100	A+B-E	111.7	>100
A+B-D	110.1	>100	B+E-A	91.3	>100
B+D-A	92.9	>100	A+E-B	95.3	>100
A+D-B	96.9	>100	A+E+C	297.5	>100
A+D+C	299.1	>100	A+E-C	96.1	>100
A+D-C	97.7	>100	E+C-A	90.5	74 - See Note 1
D+C-A	92.1	>100	A+C-E	110.9	>100
A+C-D	109.3	>100	C + D	195.6	>100


Note 1 – Due to WBVM(FM), 90.5 Mhz operating at a distance of 3.1 km for the combined site. All five transmitters were turned off while the amplitude of the signal at 90.5 MHz was observed to be unchanged, indicating that this level was not due to intermodulation products.

Table 1

DESCRIPTION	FREQ. MHZ	ATTENUATION DB	DESCRIPTION	FREQ. MHZ	ATTENUATION DB
C - D	5.8	>100	B+D-E	103.1	>100
C + (2 X D)	290.5	>100	D+E-B	86.7	>100
D + (2 X C)	296.3	>100	B+E-D	99.9	>100
(2 X C) - D	106.5	98	C + E	194	>100
(2 X D) - C	89.1	95	C - E	7.4	>100
C+B+E	298.3	>100	C + (2 X E)	287.3	>100
C+B-E	111.7	>100	E + (2 X C)	294.7	>100
B+E-C	91.3	>100	(2 X C) - E	108.1	>100
C+E-B	95.3	>100	(2 X E) - C	85.9	>100
A+D+E	291.7	>100	C+D+E	288.9	>100
A+D-E	105.1	>100	C+D-E	102.3	>100
D+E-A	84.7	>100	D+E-C	87.5	>100
A+E-D	101.9	>100	C+E-D	99.1	>100
B+D+E	289.7	>100			

While special attention was given to the “product” frequencies listed in Table 1, measurements were conducted covering the entire range of frequencies between 2.5 MHz and 550 MHz. The only signals detected at levels attenuated by less than 80 dB below the unmodulated carrier levels and appearing on frequencies removed from the station carrier frequencies by more than 600 kHz were the carriers of nearby FM and Television stations. In each case where these signals were observed to be at a level greater than -85 dBm (80 dB below the unmodulated carrier reference which was -5 dBm) all five transmitters were turned off while the amplitude of the signal was observed to be unchanged, indicating that the signal was not the result of the combined operation of WWRM(FM), WMTX(FM), WFLZ-FM, WPOI(FM) and WFUS(FM).

The results of these measurements confirm that the combined operations of WWRM(FM), WMTX(FM), WFLZ-FM, WPOI(FM) and WFUS(FM) into the shared auxiliary antenna are in full compliance with section 73.317(b) through 73.317(d) of the FCC Rules and Regulations.


 Randall L. Mullinax
 Regional Engineer
 Clear Channel Radio