

Radiofrequency Field Measurements on the
Main Roof of 4 Times Square, New York
AKA 151 West 42nd Street, New York
February 28, 2019

Prepared for WBAI-FM

John M Lyons, CPBE, MCTE
Assistant Vice President
Director of Broadcast Communications
The Durst Organization / Royal Realty

Radiofrequency Field Measurements on the

Main Roof of 4 Times Square

AKA 151 west 42nd Street, New York

February 28, 2019

Summary Conclusions

This evaluation demonstrates that RF fields found on the main roof level of the 4 Times Square building, in New York, resulting from all normal primary broadcasting facilities located at the site, including WBAI-FM, at full operating power at the time of the survey comply with the FCC MPE limits for the general public. The greatest spatial averaged RF field found represented 1.8% (mean plus one standard deviation) of the Public MPE. Generally, RF fields were significantly less in value, typically being, on average, about 0.8% of the MPE. The onsite RF measurements were conducted on February 28, 2019.

RF Field Instrumentation and Measurement Technique

The measurements were made with a Narda Microwave Model EA5091 broadband electric field strength probe (SN 01286), calibrated October 23, 2018, connected to a Narda Model NBM-550 digital broadband field meter (SN H-0662), calibrated October 15, 2018. The Model EA5091 probe is frequency shaped so that all detected fields are weighted according to the frequency variation of the MPE limit such that the meter presents the measured field as a percentage of the FCC MPE limit for occupational exposure. The probe has a capacity of measuring RF fields up to 600% of the FCC occupational MPE limit. The minimum reliable indication of the field is specified as 0.6% of the MPE limit. The meter range was set to 3% of Standard as there was no indication to expect anything higher than this value. This allowed for measurement values below 0.6% of MPE limit.

Prior to the measurements, the meter and probe were zeroed inside the building by placing the probe inside a shielded 'calibration bag' made with conductive fibers that provide approximately 20dB of attenuation of ambient RF fields. The meter was re-zeroed several times before entering onto the main roof to perform the measurements.

The measurement technique that was used consisted of determining the spatial average value of field as a percent of the MPE limit at 32 points distributed about the main roof level. This was accomplished by slowly moving the probe in a vertical line from the standing surface of the roof to head height (approximately six-foot three-inches). Each vertical scan lasted ten to twelve seconds. At each of the 32 measuring points, multiple vertical scans were obtained by standing

at different azimuths relative to the measurement point in an effort to minimize the perturbation of the local fields by the body of the observer.

All measurements were conducted and recorded by John M Lyons. Table 1 shows all measurements that correspond to points on the 4 Times Square Main Roof RF Plan which is attached.


Conclusions

The RF Survey conducted at the 4 Times Square building on February 28, 2019 with all normal primary broadcast transmitters at the site active in addition to WBAI-FM, indicates that the main roof level is compliant with the FCC MPE for the general public by a wide margin. In the worst case, the RF level was at 1.3% of standard at the main roof level.

The 4TS Site is subject to an extensive RF Safety program that provides numerous exposure control features should individuals need access to on-tower locations or other elevated locations above the main roof level. The RF Safety program is described in a paper presented at the National Association of Broadcasters Engineering Conference.¹

¹Monitoring RF Safety At A Multi-User Broadcast/Communications Site, Richard A. Tell and John M. Lyons, 2006 NAB Engineering Conference, Las Vegas, NV.


Respectfully submitted,

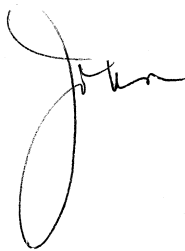A handwritten signature in black ink, appearing to read "John", with a large, stylized loop at the end.

February 28, 2019

Table 1. RF measurement data for the main roof level at 4 Times Square, February 28, 2019
Direction facing during measurement of spatially averaged RF field

Location	North	East	South	West	Overall Average	Standard Deviation
1	0.5	0.5	0.5	0.5	0.5	0.0
2	0.4	0.3	0.4	0.4	0.4	0.05
3	0.5	0.5	0.5	0.5	0.5	0.05
4	0.3	0.3	0.3	0.3	0.3	0.0
5	0.5	0.5	0.5	0.4	0.5	0.05
6	0.8	0.7	0.7	0.8	0.8	0.06
7	0.9	0.9	1.0	0.9	0.9	0.05
8	0.8	0.8	0.7	0.8	0.8	0.05
9	0.1	0.1	0.2	0.2	0.2	0.06
10	0.1	0.1	0.1	0.1	0.1	0.0
11	0.1	0.1	0.1	0.1	0.1	0.0
12	0.2	0.2	0.1	0.1	0.2	0.06
13	0.1	0.1	0.1	0.1	0.1	0.0
14	1.0	1.0	0.9	0.8	0.9	1.0
15	0.5	0.6	0.5	0.5	0.5	0.5
16	1.1	1.0	1.0	0.9	1.0	0.8
17	0.1	0.1	0.2	0.1	0.1	0.5
18	0.1	0.1	0.1	0.1	0.1	0.0
19	0.2	0.1	0.1	0.1	0.1	0.5
20	0.2	0.2	0.2	0.2	0.2	0.0
21	1.3	1.2	1.3	1.3	1.3	0.5
22	1.2	1.2	1.1	1.2	1.2	0.5
23	0.6	0.6	0.6	0.6	0.6	0.0
24	0.3	0.3	0.3	0.4	0.3	0.5
25	0.3	0.3	0.3	0.3	0.3	0.0
26	0.2	0.2	0.2	0.3	0.3	0.5
27	0.2	0.2	0.1	0.1	0.2	0.6
28	0.1	0.1	0.1	0.1	0.1	0.0
29	0.2	0.2	0.1	0.2	0.2	0.5
30	0.3	0.2	0.3	0.3	0.3	0.5
31	0.1	0.1	0.1	0.2	0.1	0.5
32	0.1	0.1	0.2	0.1	0.1	0.5

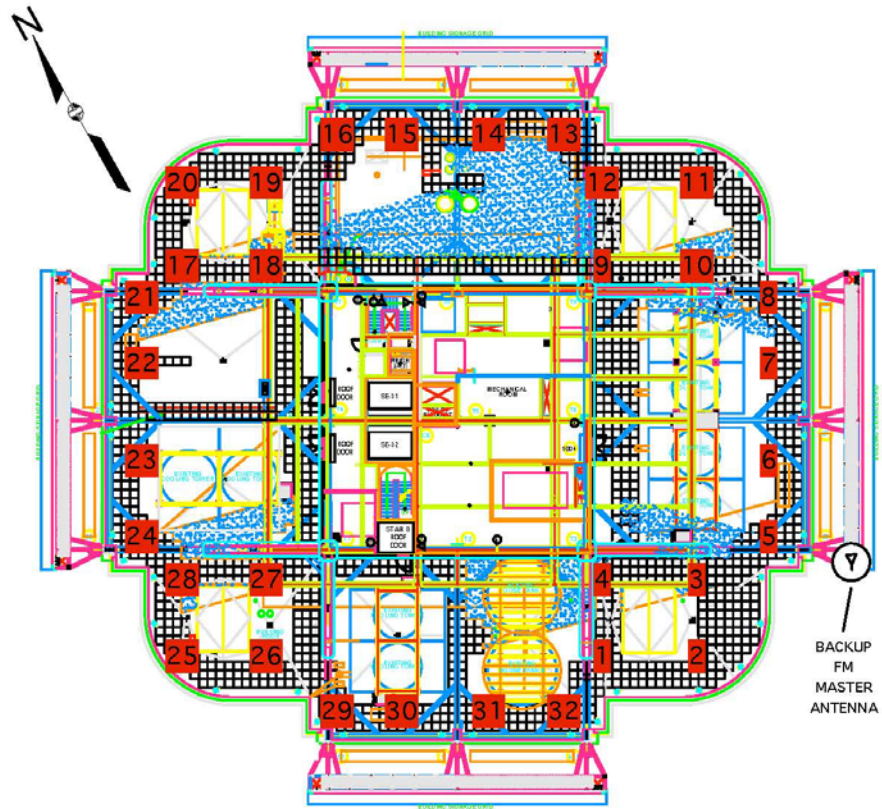

4 TIMES SQUARE
MAIN ROOF
RF PLAN

Plan of main roof level at 4 Times Square illustrating approximate locations of measurements of spatially averaged RF fields.